

# Air Monitoring Report



## Trac Laboratories Limited

Suite 5  
The Pavilions  
Bridge Hall Lane  
Bury  
BL9 7NX



Email: [projects@trac-associates.com](mailto:projects@trac-associates.com)



Web: [www.trac-associates.com](http://www.trac-associates.com)

Tel: 0161 641 8150

<b>Name and address of Client:</b>		Horizon Environmental Ltd Ovenden House Wilcox Close Aylesham CT3 3EP	
<b>Name and address of Site:</b>		Holloway Park Parkhurst road Holloway N7 0SF N7 0SF	
<b>Air test ref:</b>	DQ03	<b>Report issue date:</b>	08 Jan 2024
<b>Date of works:</b>	08 Jan 2024	<b>Report issue time:</b>	
<b>Removal contractor</b>	Horizon Environmental Ltd		
<b>Scope of works:</b>	Air testing to be conducted during land remediation.  1. Personals on all ops machine and picking station during land remediation. 2. Back ground monitoring around site.		
<b>Location of Work area:</b>	Perimeter monitoring during land remediation		

Analyst: Gabriel Malagodi

Signature:

Site Representative: Rob Redford

Signature:

# Air Monitoring Certificate



<b>Microscope No:</b>			PCM 028	<b>Stage Micrometer ref</b>	SM 043	<b>Time piece ref:</b>		<b>NPL Test slide ref:</b>	NPL 033	<b>Relevant bands visible:</b>			Yes			
<b>Slide storage box no:</b>			CB	<b>Exposed Filter diameter:</b>	22.0	<b>Hi flow meter ref:</b>	HF 011	<b>Low flow mater ref:</b>	LF 011	<b>Graticule diameter:</b>			102µm			
Sample No	Test Type	Sample Ref / Location	Pump No	Cowl No	Sampling period			Flow rate			Valume Litres	No of Fields	Fibres	Concentration f/ml	Reported result	Limit of Quantification
					Start time	Finish time	Total time (mins)	Start	End	Corrected						
1	FB	DQ002118 / Field Blank	N/A	CO114	N/A	N/A	0	N/A	N/A	0.0	0	N/A	N/A			
2	Background	DQ002119 / Perimeter	HV 012	CO115	10:07	11:18	71	8.0	8.0	8.0	568	207	2	0.0008	<0.010	0.010
3	Background	DQ002120 / Perimeter	HV 028	CO116	10:09	11:19	70	8.0	8.0	8.0	560	200	3	0.0012	<0.010	0.010
4	Background	DQ002121 / Perimeter	HV 082	CO117	10:11	11:22	71	8.0	8.0	8.0	568	200	4	0.0016	<0.010	0.010
5	Background	DQ002122 / Perimeter	HV 012	CO119	11:18	12:26	68	8.0	8.0	8.0	544	200	2	0.0009	<0.010	0.010

FB - Field blank / BT - Background Test / LT - Leak Test / RT - Reassurance Test / NS - Near Source test / FS - Far source

## Air Monitoring Certificate



<b>Microscope No:</b>		PCM 028	<b>Stage Micrometer ref</b>	SM 043	<b>Time piece ref:</b>		<b>NPL Test slide ref:</b>	NPL 033	<b>Relevant bands visible:</b>		Yes					
<b>Slide storage box no:</b>		CB	<b>Exposed Filter diameter:</b>	22.0	<b>Hi flow meter ref:</b>	HF 011	<b>Low flow mater ref:</b>	LF 011	<b>Graticule diameter:</b>		102µm					
Sample No	Test Type	Sample Ref / Location	Pump No	Cowl No	Sampling period			Flow rate			Valume Litres	No of Fields	Fibres	Concentration f/ml	Reported result	Limit of Quantification
					Start time	Finish time	Total time (mins)	Start	End	Corrected						
6	Background	DQ002123 / Perimeter	HV 028	CO120	11:20	12:28	68	8.0	8.0	8.0	544	207	4	0.0017	<0.010	0.010
7	Background	DQ002124 / Perimeter	HV 082	CO121	11:23	12:30	67	8.0	8.0	8.0	536	200	3	0.0013	<0.010	0.010
8	Background	DQ002125 / Perimeter	HV 012	CO114	12:26	13:28	62	8.0	8.0	8.0	496	203	2	0.0009	<0.010	0.010
9	Background	DQ002126 / Perimeter	HV 028	CO122	12:28	13:28	60	8.0	8.0	8.0	480	200	4	0.0019	<0.010	0.010
10	Background	DQ002127 / Perimeter	HV 082	CO123	12:30	13:30	60	8.0	8.0	8.0	480	204	4	0.0019	<0.010	0.010

FB - Field blank / BT - Background Test / LT - Leak Test / RT - Reassurance Test / NS - Near Source test / FS - Far source

# Supporting Photographs



Date and time: 08/01/2024 10:11:29  
Comments: DQ2121 Perimeter Air Monitoring



Date and time: 08/01/2024 10:08:15  
Comments: DQ2119 Perimeter Air Monitoring



Date and time: 08/01/2024 10:10:14  
Comments: DQ2120 Perimeter Air Monitoring



Date and time: 08/01/2024 11:18:46  
Comments: DQ2122 Perimeter Air Monitoring



Date and time: 08/01/2024 11:21:42  
Comments: DQ2123 Perimeter Air Monitoring



Date and time: 08/01/2024 11:23:40  
Comments: DQ2124 Perimeter Air Monitoring



# Supporting Photographs



Date and time: 08/01/2024 12:27:48  
 Comments: DQ2125 Perimeter Air Monitoring



Date and time: 08/01/2024 12:29:08  
 Comments: DQ2126 Perimeter Air Monitoring



Date and time: 08/01/2024 12:31:50  
 Comments: DQ2127 Perimeter Air Monitoring

No photographic evidence available.

Date and time:  
 Comments:

No photographic evidence available.

No photographic evidence available.

Date and time:  
 Comments:

Date and time:  
 Comments:

# Air Monitoring Report Cont'd



**Comments:**

Air monitoring was below the limit of quantification <0.01f/ml so deemed all satisfactory

Analyst:

Gabriel Malagodi

Signature:

A handwritten signature in black ink, appearing to be "G. Malagodi", written within a rectangular box.

Site Representative:


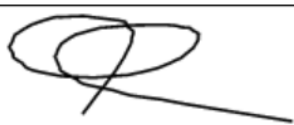
Rob Redford

Signature:

A handwritten signature in black ink, appearing to be "Rob Redford", written within a rectangular box.

# Appendix 1 - Site Plan



<b>Analyst Name:</b>	Gabriel Malagodi	<b>Analyst Signature:</b>	
<b>Date:</b> <b>Time:</b>	10 Jan 2024 10:11		
<b>Site Supervisor Name:</b>	Rob Redford	<b>Supervisor Signature:</b>	
<b>Date:</b> <b>Time:</b>	10 Jan 2024 10:11		

## Appendix 2 - Disclaimer



Opinions and interpretations contained within this report are outside the scope of UKAS accreditation.

This certificate or air test report is valid only when it bears the signature of an authorised member of Trac Laboratories Limited personnel.

Please note the witnessing of smoke tests is outside of the scope of UKAS accreditation.

Representatives Signature - The signatory on report acknowledgement agrees to findings of this report being accurate and correct.

### Accuracy of Test Results

The above sampling has been undertaken in accordance with the current version of HSG248, and documented in house procedures.

Using this method, the lowest limit of quantification LOQ for 480l sample is 0.010 f/ml. For volumes less or more than this the actual volume is stated.

Airflow measured on site is recorded against a correction chart. Flow meters are calibrated against a UKAS certified master flow meter accurate to + - 0.5%. In accordance with HSG248, If the combined effect of ambient temperature and pressure between calibration and sampling location exceeds 5% a correction is applied to the air sample volume.

The results given of each air sample taken relate to the calculated airborne concentration of respirable fibres. Where the corresponding reported fibre concentration is preceded by <, the lower of quantification (LOQ) of the method has not been reached.